

InSight Condition Report

2010 Toyota Prius 5dr HB I (Natl)

JTDKN3DU0A0122240

212,990 mi | Front Wheel Drive | 4 Cylinder Engine | CVT Transmission | Hard Top | Leather

Lane/Run 15/54 | Facilitation Manheim New Jersey | Seller CAR CASH OF NEW JERSEY LLC



AUTOGRADE
2.6
Below Average

Damages	No Structural Damage	Prior Paint	Tires	Clean
Drivable	Starts	No Odor	Keys 1 Fobs 0	Title? (No Data)




Announcements

No Announcements

High Value Options

- Keyless Start
- Tire Pressure Monitor

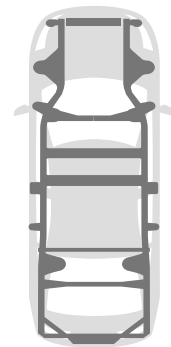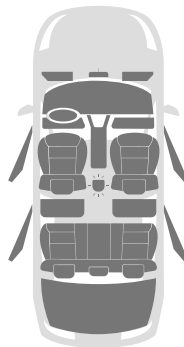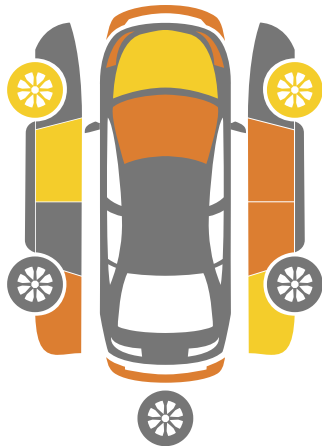


Damage Overview



None ● ● ● Severe

● Structural Issue

Exterior (17)

Description	Condition Severity	Type	Image	Additional Info
● Windshield	Cracked GR 12"	Miscellaneous		
● Front Bumper Cover	Broken Replacement Required	Paint and Body Requires Conventional Repair		
● Hood	Chipped 10 or More	Paint and Body Requires Conventional Repair		
● LF Door	Dent/No Paint Dmg PDR/1	Cosmetic Conventional Paint and Body Not Required		
● LF Wheel Cover	Broken Replacement Required	Miscellaneous		
● Left Fog Light	Broken Replacement Required	Miscellaneous		
● L Headlight	Water Damage Replacement Required	Miscellaneous		
● L Qtr Panel	Mult Dents/No Paint Dmg 2	Included Repairs fixed with Panel Repairs		
● L Qtr Panel	Mult Dents/Paint Dmg 2	Paint and Body Requires Conventional Repair		
● Rear Bumper Cover	Misaligned Repair Required	Included Repairs fixed with Panel Repairs		
● Rear Bumper Cover	Prev Repair SubStd Dirt	Previous Repair		

Description	Condition Severity	Type	Image	Additional Info
● RR Door	Mult Dents/No Paint Dmg 3	Paint and Body Requires Conventional Repair		
● Right Fog Light	Broken Replacement Required	Miscellaneous		
● R Headlight	Water Damage Replacement Required	Miscellaneous		
● R Qtr Panel	Dent/No Paint Dmg PDR/1	Cosmetic Conventional Paint and Body Not Required		
● RF Door	Mult Dents/No Paint Dmg 4	Paint and Body Requires Conventional Repair		
● RF Wheel Cover	Broken Replacement Required	Miscellaneous		

Interior (1)

Description	Condition Severity	Type	Image	Additional Info
● Warning - Tire Pressure	On Unacceptable	Miscellaneous		

Structure (0)

No structural damages reported

Other (0)

No other damages reported

Tires & Wheels


Wheels Aluminum

Left Front

Firestone
5/32"
 195/65R15

Left Rear

Firestone
6/32"
 195/65R15

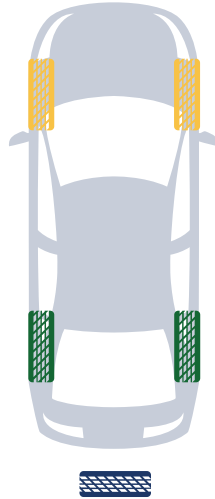

Right Front

Firestone
5/32"
 195/65R15

Right Rear

Firestone
6/32"
 195/65R15

Spare
 (Compact)
N/A

- 6/32 +
- 5/32 to 4/32
- < 4/32
- N/A

History



No. of Historical Events	18
Last Reported Event Date	01/30/2020
Calculated Owners	2
Last Reported Mileage	212,987
Calculated Accidents	0

Title and Problem Check	✔ Vehicle checks out!
Odometer Check	✔ Vehicle checks out!
Use and Event Check	! Specific vehicle use(s) or events reported
AutoCheck Buyback Protection	✔ Qualifies

CARFAX

[View CARFAX](#)

Details

Exterior Color
Winter Gray Metallic



Interior Color
Gray

Top Type
Hard Top

MSRP
Not Available

Title State
NJ

Title Received
02/05/2020

Received Date
01/28/2020

Inspection Location
Manheim New Jersey

Work Order
5733460

In Service Date
Not Available

Org Mfg Basic Warranty
Not Available
*Manheim is not
responsible for voided
warranties

Equipment

Options

- A/C
- Adjustable Steering Wheel
- AM/FM Stereo
- Automatic Headlights
- Auxiliary Audio Input
- Brake Assist
- Bucket Seats
- Cargo Shade
- CD Player
- Child Safety Locks
- Driver Air Bag
- Driver Illuminated Vanity Mirror
- Driver Vanity Mirror
- Engine Immobilizer
- Front Head Air Bag
- Front Reading Lamps
- Front Side Air Bag
- Gasoline Fuel
- Heated Mirrors
- Intermittent Wipers
- Knee Air Bag
- MP3 Player
- Pass-Through Rear Seat
- Passenger Air Bag
- Passenger Air Bag Sensor
- Passenger Illuminated Visor Mirror
- Passenger Vanity Mirror
- Power Door Locks
- Power Mirror(s)
- Power Outlet
- Power Steering
- Power Windows
- Rear Bench Seat
- Rear Defrost
- Rear Head Air Bag
- Rear Spoiler
- Stability Control
- Steering Wheel Audio Controls
- Traction Control
- Trip Computer
- Variable Speed Intermittent Wipers

Interior

- Leather
- Odometer Operable

Mechanical

- 1.8L None
- 4 Cylinder Engine
- ABS Brakes
- Continuously Variable Transmission
- Front Wheel Drive
- Gasoline Fuel

Keys

- Smart - 1

Vehicle condition reports contain representations made by the seller and subjective input based on inspector judgment, which may affect any AutoGrade score. The use of the report and any AutoGrade score is subject to the Manheim Terms

and Conditions and the NAAA Generic Condition Report Position Statement.

This grade was calculated under the assumption that some repairs may be covered under manufacturer warranty.

† Damage Overview diagrams are not an exhaustive representation of vehicle damage and should be viewed in conjunction with the damage detail list on each tab.

*Process protected under U.S. Patent No. 8,230,362

VIN: JTDMN3DU0A0122240,

Work Order: 5733460

© 2020 Manheim. All Rights Reserved

[Return to the classic CR](#)